


REPAIR OF BIOMEDICAL EQUIPMENTS UNDER BIOMEDICAL EQUIPMENT MAINTENANCE PROGRAM (BEMP)

Recommendations for Beyond Economic Repair (BER)

PROFORMA

Sl. No	Particulars	Details
1	Name of District	KOLLAM
2	Name of Hospital	UPHC ULİYAKOVIL
3	Name of Equipment with Make, Model and Serial Number	Equipment : HAEMATOLOGY ANALYSER Make: PROKAN Model: PE 6000 SN : A6006170100011EH
4	Equipment ID & Barcode	Ticket id: 124447 / Barcode : 0240195
5	Date of purchase / Year of manufacture / Installation Date	09-05-2017
6	Warranty details (Yes/No)	No warranty
7	*AMC/ CAMC Period agreed at the time of purchase	No AMC/CMC
8	Date of breakdown (Date of registration of complaint through email/ Toll free)	20-07-2024
9	Action taken	Regarding inspection of the equipment ccu board,cpu board, smps, 3way valve, 2way valve, wbc chamber, hgb lamp, tubing's are defective. Enquired spare with OEM.on 09-05-2017 machine, installed in Dh Kollam then transfred to uphc uliyakovil on 15-04-2021, then again transferred to Chc Velinalloor
10	Present status of the equipment (Fully damaged / partially damaged)	Fully damaged
11	Recommendations for repair (required service details)	Not recommending for repair.
12	Cost of spares (specify parts and cost)	3 way valve 3 nos = 55350 2 way valve 2 nos = 36900 CCU Board w/o MTB = 59500 WBC Chamber = 35250 Ccu(cpu) Board = 59500 Smps = 26250 HGB Lamp = 9250 Maintenance kit = 5700 Tubings set (T1 & T2) = 11100 Tax amount Gst 18% =19824 Total = 352584


13	Asset Value	Rs . 225645/-
14	# Percentage value of the cost of spares with respect to Cost of Purchase/ Asset Value	156.25%
15	Abstract of Service Report provided by the OEM/ Authorized Service Provider/ CYRIX (Attached or Not)	Cyrix service report , Quotation & email communication attached
16	Reasons for recommending the equipment as BER	Checked and found ccu board, cpu board, smps, 3way valve, 2way valve, wbc chamber, hgb lamp, Maintenance kit, tubing's are defective, Equipment is installed on 09-05-2017 at Dh Kollam and aged up to 7 years 2+ month. Currently machine in Chc velinalloor. Repairing cost of equipment is 156.25%. As per tender clause 5.3.14.1, both criteria met. so recommending to condemnation.
17	Name & Signature of CYRIX Authority	RAJESHLAL 

*Not mandatory #Based on the period of life and value as per the BER guidelines

* Attach Photograph

Remarks and Recommendations of Consultant (Biomedical) NHM:

checked quotation received from Aspen diagnostics. Repairing cost is very high. So recommended for Beyond economic repair


 29/8/24
 Signature of J. J. Joseph (i/c)
 BM (NHM)
 ABMO
 NHM, KOLLAM

Date 30/08/24




 Superintendent
 Medical Officer (i/c)

2118

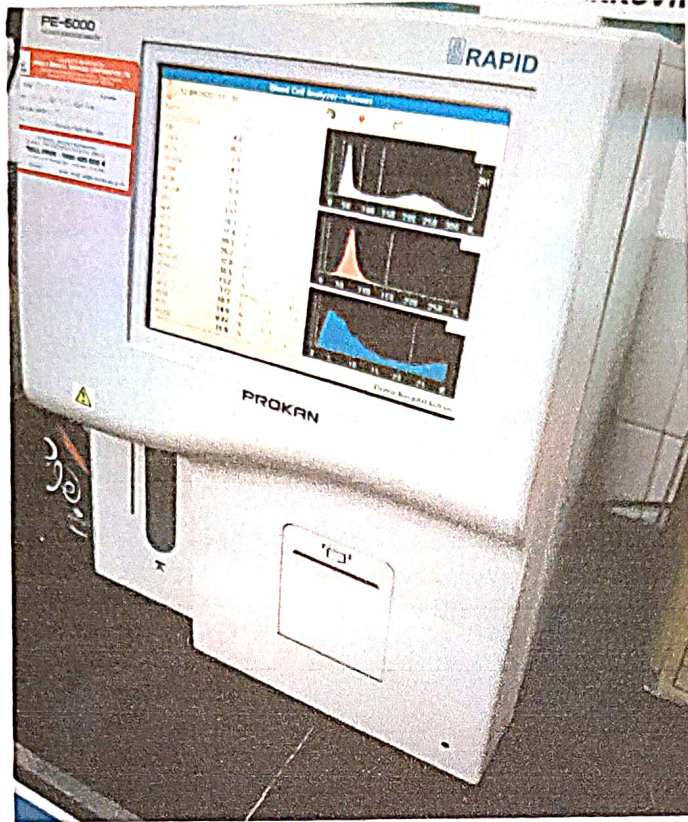
INSTALLATION REPORT

Customer's Name & Address <i>Dr. H. Kulkarni</i>	Instrument: <i>...</i>	Model: <i>...</i>
	Ser No: <i>...</i>	Software Version: <i>...</i>
	PO No: <i>...</i>	Invoice No: <i>...</i>
	Starting Date: <i>...</i>	Completion Date: <i>...</i>
Contacts:	Tel: <i>...</i> Mob: <i>...</i>	Email: <i>...</i>
Packing Inspection:	External: <input checked="" type="checkbox"/> Good <input type="checkbox"/> Damaged	Internal: <input checked="" type="checkbox"/> Good <input type="checkbox"/> Damaged
Electrical Inspection: <input checked="" type="checkbox"/>	L-N: <input checked="" type="checkbox"/> L-E: <input checked="" type="checkbox"/> N-E: <input checked="" type="checkbox"/>	UPS: <input checked="" type="checkbox"/> Yes: <input type="checkbox"/> No: <input type="checkbox"/> Capacity: <i>...</i>
Mechanical Inspection: <input checked="" type="checkbox"/>	Functional Test: <input checked="" type="checkbox"/>	Control / QC Test: <i>...</i>
Calibration Status: <input checked="" type="checkbox"/>	Assays performed	
	a. <i>...</i>	c. <i>...</i>
	b. <i>...</i>	d. <i>...</i>
Training Imparted:	Dates:	Accessories Supplied
<i>...</i>	<i>9/15/17</i>	1. <i>...</i>
<i>...</i>		2. <i>...</i>
<i>...</i>		3. <i>...</i>
<i>...</i>		4. <i>...</i>
Warranty:	From: <i>07/05/2017</i>	To: <i>07/05/2018</i>
Instrument Status:	Outright:	Rental: <i>...</i>

Customer's Remarks	Engineer's Remarks
Installation Status: <input checked="" type="checkbox"/> Good <input type="checkbox"/> Average <input type="checkbox"/> Below average Signature: <i>[Signature]</i> Medical Contacts: 0484 4012683	Notes: Remarks: Engineer's Name: <i>...</i> Engineer's Signature: <i>[Signature]</i>



അഡ്മിഷൻ നൂമറുകൾ
സാമൂഹ്യാരോഗ്യവകുപ്പ്
ബെന്തിനൂർ, ഞായൂർ പി.ഒ.



മെഷീനും മെയിനറും
 സൗകര്യപ്പെടുത്തുന്നു
 മെറ്റീരിയലും, സെയ്വിലും

FW: PRICE ENQUIRY - HAEMATOLOGY ANALYZER - UPHC ULİYAKOVIL - 0240195 - 124447

1 message

service support <servicesupport@rdgc.in>

20 August 2024 at 18:09

To: abilalcyrix@gmail.com

Cc: purchasecyrix2@gmail.com, BINTO JOSEPH <binto@rdgc.in>, service@rdgc.in, "Rajaram.rdg" <rajaram.k@rdgc.in>

Dear sir/madam,

Please find the attached P.I. & share the P.O. along with payment details for billing.

Thanks & Regards

Hari Ram

From: Abilal S [_DI Kollam_] [mailto:abilalcyrix@gmail.com]**Sent:** Monday, August 19, 2024 5:02 PM**To:** service@rdgc.in; binto@rdgc.in; service support**Cc:** Anjitha Purchase Cyrix**Subject:** PRICE ENQUIRY - HAEMATOLOGY ANALYZER - UPHC ULİYAKOVIL - 0240195 - 124447

Dear Sir,

Kindly share the Price and Stock availability of Spares needed for HAEMATOLOGY ANALYZER.

Spares Needed :

1. CCU BOARD
2. CPU BOARD
3. SMPS
4. 3 WAY VALVE - 3nos
5. 2-WAY VALVE - 2nos
6. PM KIT
7. WBC CHAMBER
8. HGB ASSEMBLY
9. T1 T2 Tubings Set - 1

Hospital : UPHC ULİYAKOVIL

Make : ASPEN DIAGNOSIS (RAPID -PROKAN)

Model : PE-6000

SI No : A6006170100011EH

Barcode. : 0240195

-

Thanks and Regards


ABILAL .S

District incharge

CYRIX HEALTHCARE Pvt. Ltd

Kollam - 691002

Ph:+91 7693847161

 **IMG_0005.pdf**
1448K

15/4/21

Haematology Analyser - 1 No
model / Batch No DC 6000 Received from DH Kollam²⁵
Automated Specific Protein Analyser (HbA1c)

25/10/21

HSN/SD - 90278090 Product code - 21516100
Invoice Amt ₹ 38350.00

(HbA1c control level 1.82
HbA1c no. sps ~ 12)

MEDICAL OFFICER
URBAN PRIMARY HEALTH
ULIYAKOVIL, KOLLAM

→ 16.9.21

DC No. 410/21-22

Cat 6 patch panel 24	- 1 No.	- 4354.00
24 port 10/100/100 managed switch	- 1 No.	- 15186.00
13 port PoE switch	- 1 No.	- 37823.00
Barcode scanner	- 1	- 3699.00
inkjet printer	- 3	- 25324.00
Barcode/stick printer	- 1	14358
Thermal printer	- 1	12558
QR code scanner	- 1	5929.

30.9.21

19.5 inch ips monitor - 1 No



Handwritten signature and text: സാമൂഹ്യാരോഗ്യകേന്ദ്രം വെളിനല്ലൂർ, തൃശ്ശൂർ പി.ഒ.



Aspen Diagnostics Pvt. Ltd.

(Rapid Diagnostic Group Of Companies)



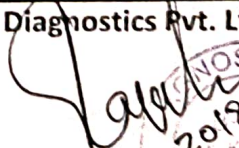

ISO 9001:2015
CERTIFIED COMPANY

Proforma Invoice No.: ADPL/S/RD/20240820/24-25				Date :20-08-2024	
To, Cyrix Healthcare Pvt. Ltd. Kollam-691002				Ref. : By Mail.	
				Date :20-08-2024	
				UPHC ULİYAKOVIL	
Sr. No	Description	Part No.	Price Each Ex- Work	Qty	Total (In Rs.)
	(Instrument Model: Hematology Analyzer) (Model : PE-6000) (S/No. A6006170100011EH)				
A	<u>Consumables Procurement Details:</u>				
I	Maintenance Kit	PE00-034	5,700.00	1	5,700.00
II	Tubing Set Complete (T1 & T2)	NA	11,100.00	1	11,100.00
Total					16,800.00
(+) GST @ 18%					3,024.00
Total: Nineteen Thousand Eight Hundred Twenty Four Only.					19,824.00

Terms & Conditions : { Validity: 90 Days } { Delivery : 3-4 Weeks } { Payment Terms : 100% Advance }

Bank Account Details :- @Mg

Name of the Firm : Aspen Diagnostic Pvt. Ltd.
Bank Name : ICICI Bank Limited
Account No. : 016005003239
Account Type : Current Account
MICR Code : 110229029
IFSC Code : ICIC0000160

Aspen Diagnostics Pvt. Ltd.

Rajaram Krishnamurthy
National Service Manager




Aspen Diagnostics Pvt. Ltd.

(Rapid Diagnostic Group Of Companies)



Proforma Invoice No.: ADPL/S/RD/20240820/24-25				Date :20-08-2024	
To, Cyrix Healthcare Pvt. Ltd. Kollam-691002				Ref. : By Mail. Date :20-08-2024	
				UPHC ULIYAKOVIL	
Sr. No	Description	Part No.	Price Each Ex- Work	Qty	Total (In Rs.)
	(Instrument Model: Hematology Analyzer) (Model : PE-6000) (S/No. A6006170100011EH)				
A	<u>Spares Procurement Details:</u>				
I	3-Way Valve	PE00-006	18,450.00	3	55,350.00
II	2-Way Valve	PE00-005	18,450.00	2	36,900.00
III	CCU Board	PE60-010	59,500.00	1	59,500.00
IV	WBC Chamber	PE60-003	35,250.00	1	35,250.00
V	CCU Board	PE60-010	59,500.00	1	59,500.00
VI	Switching Power Supply	PE00-013	26,250.00	1	26,250.00
VII	HGB Lamp	PE60-041	9,250.00	1	9,250.00
Total					2,82,000.00
(+) GST @ 18%					50,760.00
Total: Three Lakh Thirty Two Thousand Seven Hundred Sixty Only.					3,32,760.00

Terms & Conditions : (Validity: 90 Days) (Delivery : 3-4 Weeks) (Payment Terms : 100% Advance)

Bank Account Details :-

Name of the Firm : Aspen Diagnostic Pvt. Ltd.
Bank Name : ICICI Bank Limited
Account No. : 016005003239
Account Type : Current Account
MICR Code : 110229029
IFSC Code : ICIC0000160

Aspen Diagnostics Pvt. Ltd.

20/8/24
Rajaram Krishnamurthy
National Service Manager