


**REPAIR OF BIOMEDICAL EQUIPMENTS UNDER BIOMEDICAL EQUIPMENT
MAINTENANCE PROGRAM (BEMP)**

482

Recommendations for Beyond Economic Repair (BER)

PROFORMA

Sl. No	Particulars	Details
1	Name of District	THIRUVANANTHAPURAM
2	Name of Hospital	CDH PULAYANARKKOTTA
3	Name of Equipment with Make, Model and Serial Number	Equipment : CENTRIFUGE Make: REMI Model : R8C SN : GNLC-4503
4	Equipment ID & Barcode	104069 & 0114376
5	Date of purchase / Year of manufacture /Installation Date	27.08.2005
6	Warranty details (Yes/No)	No warranty
7	*AMC/ CAMC Period agreed at the time of purchase	No AMC/CMC
8	Date of breakdown(Date of registration of complaint through email/ Toll free)	01-04-2024 (Toll free)
9	Action taken	Checked the machine and found the transformer, speed regulator and motor faulty. Enquired for spare with OEM.
10	Present status of the equipment (Fully damaged / partially damaged)	Fully damaged
11	Recommendations for repair (required service details)	Not recommending for repair.
12	Cost of spares (specify parts and cost)	Electric Motor – Rs.8284/- Speed regulator – Rs.2356/- Transformer – Rs.971/- Total amount including GST – Rs.11611/-

13	Asset Value	Rs.9651
14	#Percentage value of the cost of spares with respect to Cost of Purchase/ Asset Value	120%
15	Abstract of Service Report provided by the OEM/ Authorized Service Provider/ CYRIX (Attached or Not)	Cyrix service report and Quotation from OEM attached
16	Reasons for recommending the equipment as BER	Checked the machine and found the transformer, speed regulator and motor defective. Equipment installed on 27.08.2005 and has covered up to 18+ years. Repair cost is 120%. Quotation submitted. Both criteria met and hence recommending the equipment for condemnation as per clause 5.3.14.1.
17	Name & Signature of CYRIX Authority	AKHIL MANOHAR 


*Not mandatory #Based on the period of life and value as per the BER guidelines

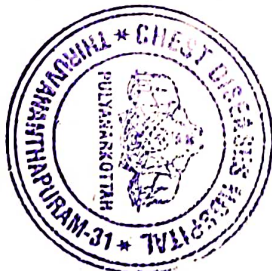
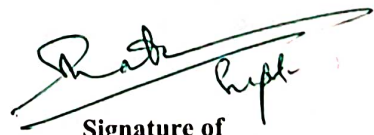
* Attach Photograph

Remarks and Recommendations of Junior Consultant (Biomedical) NHM:

Transformer and Speed regulator with motor fully defective. So can RBER.

MANEESHA MOHAN M.R.
Junior Consultant (Biomedical)
National Health Mission
Thiruvananthapuram


22-4-2024
Signature of JC BM (NHM)

		
Date	Seal	 Signature of Superintendent / Medical Officer (i/c)

Superintendent
Chest Diseases Hospital
Pulayanankottah



BIOMEDICAL EQUIPMENT MAINTENANCE PROGRAMME UNDER NATIONAL HEALTH MISSION



SERVICE PROVIDER
Tender No. WO-37/2021-2022/698

CYRIX

HEALTHCARE PVT LTD

No. : 193109

ISO 13485 : 2012 & ISO 9001-2008 CERTIFIED COMPANY | AERB Approved Service Agency

Service Report

30/64 1 B, Petta Junction, Poonithura, Kochi - 682 038, Kerala
Ph : 98472 99500 Website : www.cyrix.com | E-mail : bemp.kl@cyrix.in

<p>Health Facility <u>C.D.H</u></p> <p>Address <u>Phalayanarkotta</u> <u>Thiruvananthapuram</u></p> <p>Ph : <u>9497667750</u></p>	<p>Call Registration Date : <u>01-04-2024</u></p> <p>Caller ID : <u>104069</u></p> <p>Date of Visit : <u>03-04-2024</u></p> <p>Asset No. : <u>0114376</u></p> <p>EQPT Name : <u>Centrifuge</u></p> <p>Manufacture <u>Remi</u> Model : <u>R-8C</u></p> <p>S. No. <u>GNL-4509</u> Dept. <u>Lab</u></p>
---	--

Service Classification : Breakdown Call PMS Calibration Cust.Training

Problem Identified : Not working.

Action Taken : Checked the machine. problems found in the motor side and body side. Motor is damaged and the transformer is faulty. Need to replace the motor, carbon brushes and the transformer. The equipment body is completely rusted.

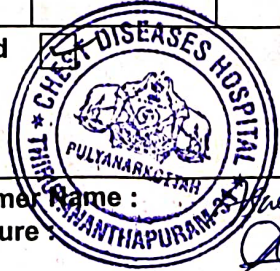
Completed Date : 03/4/24 Time : 02:00 pm Spare Required

Spare Replaced Requested

1.	Description	Qty.	Part Number	PR Number
2.	<u>NA</u>	<u>-</u>	<u>-</u>	<u>-</u>
3.				

Cyrix Engineer	Date	Start Time	End Time
<u>Akshil Manohar</u>	<u>03/4/24</u>	<u>02:00 pm</u>	<u>03:00 pm</u>

Customer Remark	Completed	Pending
	<input checked="" type="checkbox"/>	<input type="checkbox"/>



<p>Service Engineer Name : <u>Akshil manohar</u></p> <p>Signature : <u>[Signature]</u></p> <p>Date : <u>03/04/2024</u></p> <p>Contact Number : <u>8921568751</u></p>	<p>Customer Name : <u>[Signature]</u></p> <p>Signature : <u>[Signature]</u></p> <p>Date : <u>3/4/24</u></p> <p>Contact Number : <u>7306313829</u></p> <p>Designation : <u>Lab technician</u></p> <p>Hospital Seal : <u>[Seal]</u></p>
--	---

CENTRIFUGE III

27-8-05

Received from Hop store

Receipt
01

Issued

Working

Not working

REMI R8C

12 cup centrifuge

Catalogue no 7/05

SL no: GNLC 4503

Issued to lab

01

01

26.3.19

Complaint Registered on KIRLOSKER

No: 80427

Q

27.3.19

Complaint Rectified. Replaced
Carbon brushes ~~Motor~~ ^{Motor} not working
Centrifuge working no. 58240

Q



Superintendent
Chest Diseases Hospital
Puliyankottai



TEST
PULYANARKOTIAN
THIRUVANANTHAPURAM-51

Super
Chast Diesels
Puliyankotian

REMI CENTRIFUGE
CHALLENGE NO. RSC 4/0
SERIAL NO. 1830 AMBERG 314
REMI MOTORS LTD.
MUMBAI, INDIA - 400 753

CYRIX MEDICAL EQUIPMENT MAINTENANCE
TOLL FREE NO-1-800-425-7669
SAR CODE - (8004-890615225)
0714376

(414)09/25401721565



St. Joseph's Hospital
Chest Disease Dept
Punjab, India



R-8C LABORATORY CENTRIFUGE

REMI



Superintendent
Daxas Hospital
Choral
Puda