


PROFORMA
**RECOMMENDATION FOR BEYOND ECONOMIC REPAIR (RBER)
 BIOMEDICAL EQUIPMENT MAINTENANCE PROGRAM (BEMP)**

Name of Hospital: THQH KUNNAMKULAM	Name of District: THRISSUR
Name of Equipment: Fully auto Biochemistry Analyzer	Equipment ID & Barcode: 127732 & 0822564
Make: Erba	Model: Em-360
Serial Number: 69503	Warranty details: No Warranty
Date of purchase/Year of manufacture/ Installation Date: Ticket master installation date -02-05-2015. As per Stock book installation date is 05-02-2015	Present status of the equipment: Fully damaged
Date of breakdown: 06-08-2024	*AMC/ CAMC Period agreed
Date of registration of complaint through email/Toll free): Toll free	at the time of purchase: No AMC/CAMC
Action taken: Machine checked and found Err showing analyzer not responding at com, found RGT cooling assy with 6mm plate & spacer XLV2, Assembly of photometer with packing, internal tubing kit and connector, RIPT Assy for XL-600/300, Big knf pump assy, cuvette ring set assembly and cuvettes are defective. Need to replace these spares for further checking working condition of equipment, Enquired oem for spares.	
Recommendations for repair (required service details): Not Recommending	
Cost of spares (specify parts and cost): RGT Cooling Assy With 6mm Plate & Spacer XLV2 – 95335/- Assembly Of Photometer With Packing -324875/- Total Internal Tubing Kit With Connectors – 75670/- RIPT Assy For XL-600/300 – 772450/- Big Knf Pump Assy – 52210/- Cuvette Ring Set Assembly -49795/- Cuvettes – 5405/- Total – 994635/- GST – 179034/- TOTAL – 1173669/-	

#Percentage value of the cost of spares with respect to Cost of Purchase/ Asset Value: 108.4%	Asset Value: 1082525/-
---	------------------------

Abstract of Service Report provided by the OEM/ Authorized Service Provider/ CYRIX (Attached or Not): OEM Quotation attached and Cyrix report attached

Reasons for recommending the equipment as BER: Machine checked and found Err showing analyzer not responding at com, Found RGT cooling assy with 6mm plate & spacer XLV2. Assembly of photometer with packing, internal tubing kit and connector, RIPT Assy for XL-600/300, Big knf pump assy, cuvette ring set assembly and cuvettes are defective. Ticket master installation date 02-05-2015, As per stock book Machine installed on 05-02-2015 aged up to 9 years and 06 months (Stock book attached for reference). The repairing cost is 108.4% of asset value and both criteria met for RBER. So as per tender clause 5.3.14.1 equipment recommending for condemnation.



Bijo t joy 
 Name & Signature of CYRIX Authority with date

Remarks of Junior Consultant (Biomedical) NHM:
Spare cost is very high

Recommended for BER (Yes/ No): <i>Yes</i>	
Date:	Signature of JC BM (NHM) <i>20/11/24</i>

Date:	Signature of Superintendent / Medical Officer (i/c)
-------	---

*Not mandatory #Based on the period of life and value as per the BER guidelines *Attach Photograph

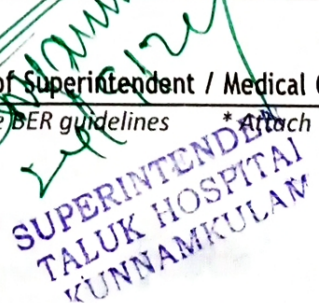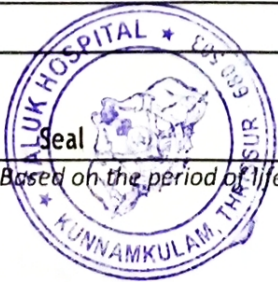



BIOMEDICAL EQUIPMENT MAINTENANCE PROGRAMME UNDER NATIONAL HEALTH MISSION



SERVICE PROVIDER
Tender No. WO-37/2021-2022/698

No : 1006627

CYRIX[®]

HEALTH CARE PVT LTD

ISO 13485 : 2012 & ISO 9001-2008 CERTIFIED COMPANY | AERB Approved Service Agency

Service Report

30/64 1 B, Petta Junction, Poonithura, Kochi- 682 038, Kerala
Ph : 98472 99500 Website : www.cyrix.com | Email : bemp.kl@cyrix.in

<p>Health Facility: <u>THQH Kunnammkulam</u></p> <p>Address: <u>Kunnammkulam</u> <u>Thrissur</u></p> <p>Ph: <u>8943923658</u></p>	<p>Call Registration Date: <u>06/08/24</u></p> <p>Caller ID: <u>127732</u></p> <p>Date of Visit: <u>07/08/24</u></p> <p>Asset No: <u>0822564</u></p> <p>EQPT Name: <u>Auto Biochemistry Analyser</u></p> <p>Manufacture: <u>Erba</u> Model: <u>Em-360</u></p> <p>S. No: <u>69503</u> Dept: <u>Laboratory</u></p>
---	--

Service Classification : Breakdown call PMS Calibration Cust. Training

Problem Identified : machine not responding at com.

Action Taken : machine checked and found Error showing, analysed not responding at com. found RUT Cooling assy with 6mm plate & spacer x LV2, assembly of photometer with piping, internal tubing kit and connector, R.I.P.T. assy for XL-600/300, Big knf pump assy, curvette ring set assembly and Curvettes one defective. Need to replace these spares for further checking. Enquire oem for spares

Completed Date : 7/8/24 Time : 1:00pm Spare Required


Spare Replaced Requested

Description	Qty.	Part Number	PR Number
1. RUT Cooling Assy with 6mm plate & spacer XLV2	1		
2. Assembly of photometer with piping	1		
3. Big knf pump Assy & R.I.P.T Assy for XL 600/300	1		

Cyrux Engineer	Date	Start Time	End Time
<u>SINTO JOY</u>	<u>7/8/24</u>	<u>9:00AM</u>	<u>1:00pm</u>

Customer Remark Completed Pending

<p>Service Engineer Name : <u>SINTO JOY</u></p> <p>Signature: <u>[Signature]</u></p> <p>Date: <u>7/8/24</u></p> <p>Contact Number: <u>7907406353</u></p>	<p>Customer Name : <u>Shereetha</u></p> <p>Signature: <u>[Signature]</u></p> <p>Date: <u>7/8/24</u></p> <p>Contact Number: <u>8943923658</u></p> <p>Designation : <u>Sc Lab Technician</u></p> <p>Hospital Seal</p>
--	---

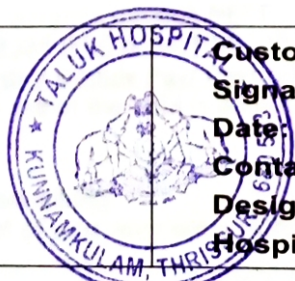

TANCANNUR
29/8/24

SUPERINTENDENT
TALUK HOSPITAL
KUNNAMKULAM

QUOTATION

Bill To: CYRIX HEALTHCARE PVT LTD
First Floor,petta Junction 30/641b, Poonithura,Ernakulam, Kerala,
Pincode 682038 , Thrissur , Kerala 680500


Ref. No : 2425QUOTE001931
Date : Sep 19, 2024 1:32 PM
Validity : 30 days
TBM GSTIN : 27AAACTP2038C1ZT

Customer GSTIN No : 32AAFCC2499H2ZM

Ship to, taluk hospital Medical superintendent
Taluk Hospital Kunnankulam , Thrissur , Kerala 680500

SUB : QUOTATION FOR SUPPLY/REPLACEMENT OF SPARES IN INSTRUMENT MODEL: EM360 SR.NO.: 60503

With reference to the above, following Spares / Consumables are required to be replaced / supplied. Price/s of the same Is / are given below, for approval:

SR. NO	Part Code	HSN Code	Description of Spares/Consumables	Qty	Unit Price	Discount%	GST%	Amount	
1	114595	90278990	RGT COOLING ASSY WITH 6MM PLATE & SPACER_XLV2	1	95335		18	95335	
2	103093	90278990	ASSEMBLY OF PHOTOMETER WITH PACKING	1	324875		18	324875	
3	104951	90278990	TOTAL INTERNAL TUBING KIT WITH CONNECTOR (XL600/300/V2/A4/EM360)	1	75670		18	75670	
4	105281	90278990	R1PT ASSY(SPARE) FOR XL-600/300	1	72450		18	72450	
5	182496	90278990	Big Knf Pump Assy.	1	52210		18	52210	
6	182530	90278990	Cuvette Ring Set Assembly (WØ Cuvettes)	1	49795		18	49795	
7	100279	70171000	CUVETTES	60	5405		18	324300	
Merchant Name : TRANSASIA BIO-MEDICALS LTD								Total (Rs)	994635
<p>SCAN AND PAY WITH UPI QR</p> <p>Merchant Name: TRANSASIA BIO MEDICALS LTD</p>  <p>Payee VPA: transasiabiomedicalsltd@citibank</p>								Discount (Rs.) (-)	
								GST (Rs.)	179034.3
								Rupees in words: Eleven lakhs Seventy Three thousand Six hundred Sixty Nine rupees and Three paise only	Grand Total (Rs.)

TERMS AND CONDITIONS :

- Payment :** Full payment should be made in advance through NEFT / RTGS/ Demand Draft in favour of "**Transasia Bio-Medicals Ltd**" to **Bank A/C no.: 00600330002538 IFSC code: HDFC0000060, UPI ID : transasiabiomedicalsltd@citibank.** You can also pay us through **UPI apps like BHIM/ Google Pay/ Paytm/PhonePe** etc. by scanning the above mentioned code. Cash Payment is strictly prohibited. No employee of the TBM is authorized to collect cash and or issue receipt against collection of Cash.
- GST :** As applicable
- Other Cost / Local duties :** Customer's responsibility
- Delivery :** Within 1-2 weeks from the receipt of your work order with payment confirmation

Thanking You

RECEIVED & ACCEPTED

Your faithfully,
For **TRANSASIA BIO-MEDICALS LTD**


CUSTOMER SIGNATURE & STAMP:
CUSTOMER NAME: _____
CONTACT NO: _____

TRANSASIA BIO-MEDICALS LTD.

Head Office: Transasia House. 8. Chandivali Studio Road, Andheri (E), Mumbai - 400 072. Tel.: (022) 4030 9000 Fax: (022) 2857 3030 Mumbai : Toll Free No. 1800 103 8226.
Whatsapp No.: 8451048434, SMS No.: 9212433444

www.transasia.co.in

DOC NO : SC00-405 / ISS - 7





REQUIRED ONE TIME SERVICE FOR FULLY AUTO BIOCHEMISTRY ANALYZER- 0822564 #127732 @THQH KUNNAMKULAM

2 messages

DM Sarang-KLBEMP <dm1.klbemp@cyrix.in>
To: SANDEEP DAS M <s.das@transasia.co.in>
Cc: Blesson Jose <zm2.klbemp@cyrix.in>, Bijo T Joy <bijocyrix@gmail.com>

Thu, 5 Sept, 2024 at 7:50 pm

Dear sir,

There is a complaint reported from THQH KUNNAMKULAM, THRISSUR Regarding the complaint with FULLY AUTO BIOCHEMISTRY ANALYZER. We required your One Time service support for rectifying the complaint.

EQUIPMENT NAME- FULLY AUTO BIOCHEMISTRY ANALYZER
MAKE- ERBA
MODEL- EM 360
SL NO- 60503
COMPLAINT- Err showing Analyzer not responding at com

Kindly do the need full at the earliest.

Thanks & Regards

Sarang.k.m
Divisional Manager | North Zone
Bemp-Kerala
Mobile : +91 7593847150
Email : dm1.klbemp@cyrix.in

CYRIX HEALTHCARE (P) LTD
30/641B | Petta | Punithura | Kochi | Kerala- 682038
www.cyrixhealthcare.com

SANDEEP DAS M <s.das@transasia.co.in>
To: DM Sarang-KLBEMP <dm1.klbemp@cyrix.in>
Cc: Blesson Jose <zm2.klbemp@cyrix.in>, Bijo T Joy <bijocyrix@gmail.com>

Thu, 19 Sept, 2024 at 1:56 pm

Dear Mr. Sarang ,

Please find the Quote for repairing the EM 360 instrument

Get Outlook for Android

From: DM Sarang-KLBEMP <dm1.klbemp@cyrix.in>
Sent: Thursday, September 5, 2024 7:50:26 PM
To: SANDEEP DAS M <s.das@transasia.co.in>
Cc: Blesson Jose <zm2.klbemp@cyrix.in>; Bijo T Joy <bijocyrix@gmail.com>
Subject: REQUIRED ONE TIME SERVICE FOR FULLY AUTO BIOCHEMISTRY ANALYZER- 0822564 #127732 @THQH KUNNAMKULAM

[Quoted text hidden]

Fully Automatic Biochemistry Analyser (Model 1-9).

5-2-15	Received from the store.				
	Automatic Biochemistry Analyser	1		1	2
	Water treatment Plant	1			
	Rs 11,55,181-				
	(Eleven lakhs Ninety five thousand)				
	One hundred and eighty one only)				
	Air water path	125ml.			
	Sample cup.	1000 ml			
	Variable pipette	10-100μl			
	Uninterrupted Power supply	2KVA			
20-2-24	Rtd from the store				
	Fully Automatic Clinical Chemistry	1 No		2 Nos	2
	Bs 390 Analyser				





