- / WEBERRINE	NCE PRO	GRAMM	AI	AL HEALTH HISSON
h Martional	HEALTH			ആരോഗ്യകേരളം
ERVICE PROVIDER ender No. WO-37/2021-2022/698	HCAREPV	X	No. : 22924	4
ISO 13485 : 2012 & ISO 9001-2008 CI			ervice Agency	
Service Report 30/64 1 B, Petta Junctio Ph : 98472 99500 Website :	on, Poonithura, Ko www.cyrix.com	chi - 682 038, Kei E-mail : bemp.kl	rala @cyrix.in	
Bert La Denard Protection	Call Regist	ration Date :	22.07.	2024
Health Facility GH. PLAPPUZHA		12460		
	Detection	it: 23.0		
Address ALAPPLIZHA (D).		04		
		e: Ella		
Ph : 8289919775		re BPL		
		MTOB33822		-
· · · ·				
Service Classification : Breakdown Call		Calibratio	n Cust.	Training _
AND LOW BATTERY EQUIPMENT 15 TRANS Action Taken : ON LHECKING FOU DEFECTIVE BATTERY	BACKUP, SFERRED FA MD THAI 155UE D	MAIN BO	IAPPUZHA MARD 15 MAIN BO	ÎOLSNOOR ARD.
AND LOW BATTERY EQUIPMENT 15 TRANS Action Taken : ON LHECKING FOU DEFECTINE BATTERY MONTAGE SUPPLY BATTERY HI 16 DEFECTINE	BACKUP SFERRED FA MD THAI 155UE D AVING 201	DOM.GH.AL MAIN BO DUE TO M I BOCKUP.	IAPPUZHA MARD 15 MAIN BO THERMAI	ÎOLSNOOR ARD. HEAD
AND LOW BATTERY EQUIPMENT 15 TRANS Action Taken : ON CHECKING FOU DEFECTINE BATTERY MONTAGE SUPPLY BATTERY H 15 DEFECTIVE Completed Date : 23.07.24 Time	BACKUP SFERRED FA MD THAI 155UE D AVING 201	DOM.GH.AL MAIN BO DUE TO M I BOCKUP.	IAPPUZHA MARD 15 MAIN BO THERMAI	ÎOLSNOOR ARD.
AND LOW BATTERY EQUIPMENT 15 TRANS Action Taken : ON CHECKING FOU DEFECTINE BATTERY MONTAGE SUPPLY BATTERY IS DEFECTIVE Completed Date : 23.07.24 Time Spare Replaced Requested	BACKUP SFERRED FA MD THAI 155UE D AVING 201	DOM.GH.AL MAIN BO DUE TO M I BOCKUP.	ВРРЦЗНА Ф. R. P. 15 Ман. Во ТНЕПМА Spare	ÎOLS NOOR ARD. HEAD
AND LOW BATTERY EQUIPMENT 15 TRANS Action Taken : ON LHECKING FOU DEFECTIVE BATTERY MOLTAGE SUPPLY BATTERY H 16 DEFECTIVE Completed Date : 23.07.24 Time Spare Replaced Requested Description	BACKUP. SFERRED FR MD THAJ ISSUE R AVING 201	DOM.GH.AL MAIN BO DUF TO 1 I BACKUP	ВРРЦЗНА Ф. R. P. 15 Ман. Во ТНЕПМА Spare	Required
AND LOW BATTERY EQUIPMENT IS TRANS Action Taken : ON CHECKING FOU DEFECTINE BATTERY I/DUTAGE SUPPLY BATTERY H IS DEFECTIVE Completed Date : 23.07.24 Time Spare Replaced Requested Description 1.	BACKUP. SFERRED FR MD THAJ ISSUE R AVING 201	DOM.GH.AL MAIN BO DUF TO 1 I BACKUP	ВРРЦЗНА Ф. R. P. 15 Ман. Во ТНЕПМА Spare	Required
AND LOW BATTERY EQUIPMENT IS TRANS Action Taken : ON CHECKING FOU DEFECTIVE BATTERY LOUTAGE SUPPLY BATTERY H 16 DEFECTIVE Completed Date : 23.07.24 Time Spare Replaced Requested Description 1. 2.	BACKUP. SFERRED FR MD THAJ ISSUE R AVING 201	DOM.GH.AL MAIN BO DUF TO 1 I BACKUP	APPU2HA ARD 15 MAIN BO THERMAL Spare	Required
AND LOW BATTERY EQUIPMENT IS TRANS Action Taken : ON CHECKING FOU DEFECTIVE BATTERY LOUTAGE SUPPLY BATTERY H 16 DEFECTIVE Completed Date : 23.07.24 Time Spare Replaced Requested Description 1. 2.	BACKUP. SFERRED FR MD THAJ ISSUE R AVING 201	POM.GH.AL MAIN BO DUF TO M BRIKUP	APPU2HA ARD 15 MAIN BO THERMAL Spare	IOLS None   ARD.   HEAD   Required   PR Number   End Time
AND       LOW BATTERY         EQUIPMENT       15 TRANS         Action Taken : ON       CHECKING FOUR         DEFECTINE       BATTERY         MOLTAGE       SUPPLY         BATTERY       His         DEFECTIVE       BATTERY         IS       DEFECTIVE         Completed       Date : 23.07.24         Description       1.         2.       3.         Cyrix Engineer	BACKUP. SFERRED FR MD THAJ ISSUE R AVING 201	POM.GH.AL MAIN BO DUF TO M I BACKUP	APPU2HA ARD 15 MAIN BO THERMAL Spare	Required
AND LOW BATTERY EQUIPMENT IS TRAWS Action Taken : ON CHECKING FOU DEFECTIVE BATTERY MOLTAGE SUPPLY BATTERY IS DEFECTIVE Completed Date : 23.07.24 Time Spare Replaced Requested Description 1. 2. 3. Cyrix Engineer	BACKUP SFERRED FR ISSUE F AND THAT ISSUE F AVING 204 S: SOPM	POM.GH.AL MAIN BO DUF TO M BRIKUP	APPU2HA ARD 15 MAIN BO THERMAL Spare	IOLS NOOP   ARD:   HEAD   Required   PR Number     End Time   \$130PM
AND LOW BATTERY EQUIPMENT IS TRANS Action Taken : ON CHECKING FOU DEFECTIVE BATTERY MONTAGE SUPPLY BATTERY IS DEFECTIVE Completed Date : 23.07.24 Time Spare Replaced Requested Description 1. 2. 3. Cyrix Engineer SAUBAN BIN YE	BACKUP SFERRED FR MD THAT ISSUE F AND THAT ISSUE F AND THAT ISSUE F AND THAT ISSUE F AND THAT AND THAT	Pom.G.H.A.	APPU2HA ARD 15 MAW BO THERMAL Spare Nber Start Time 3:30 PM Pendir	IOLS NOOP   ARD:   HEAD   Required   PR Number     End Time   \$130PM
Action Taken : ON CHECKING FOU DEFECTINE BATTERY MOLTAGE SUPPLY BATTERY H IS DEFECTIVE Completed Date : 23.07.24 Time Spare Replaced Requested Description 1. 2. 3. Cyrix Engineer SAUBAN BIN YE Customer Remark	BACKUP SFERRED FR MD THAT ISSUE F AND THAT ISSUE F AND THAT ISSUE F AND THAT ISSUE F AND THAT AND THAT	Pom.G.H.A.	APPU2HA ARD 15 MAW BO THERMAL Spare Nber Start Time 3:30 PM Pendir	IOLS NOOP   ARD:   HEAD   Required   PR Number     End Time   \$130PM
Action Taken : ON CHECKING FOU DEFECTINE BOTTERY NOLTAGE SUPPLY BOTTERY H IS DEFECTIVE Completed Date : 23.07.24 Time Spare Replaced Requested Description 1. 2. 3. Cyrix Engineer SAUBAN BIN YE Customer Remark	BACKUP SFERRED FR MD THAT 155UE D AND THAT 155UE D AND 2014 SEEN Completed	Port Nur Part Nur Date 23.07.24 er Name; St	APPU2HA ARR 15 MAW BO THERMAL Spare Nber Start Time 3:30 PM Pendir	IOLS None   ARD.   HEAD.   Required   PR Number   End Time   \$130PM   Ng
EQUIRMENT       15 TRANS         Action Taken : ON       LHECKING, FOUR         DEFECTINE       BATTERY         MONTAGE       SUPPLY         BOTTERY       Hu         Spare Replaced       Requested         Description       1         1.       Service Engineer         SAUBAN       BIN         Vertee       Service Engineer Name :         Service Engineer Name :       SAUBAN	BACKUP SFERRED FR MD THAT 155UE D AND THAT 155UE D AND 2014 SEEN Completed	Pom.G.H.A.	APPU2HA ARR 15 MAW BO THERMAL Spare Nber Start Time 3:30 PM Pendir	IOLS None   IOLS None

KMSCL Larrer to addit both	BIOMEI MAINTEN NATIONA	ANCE F	R	IME	HEALTH HEALTH
SERVICE PROVIDE	P8 C		PVTLTD	R	No: 1009315
Service Report	12 & ISO 9001-2008 C 30/64 1 B, Petta June : 98472 99500 Website	ction, Poonit	hura Kochi- 68	2 038. Kerala	
Health Facility			aller ID : ate of Visit :	124697	2.07.2024 1.2024
Ph:8.5	189919335	E	QPT Name : lanufacture	ECG N 3PL N	IQCIAINIE Nodel: CARDIARIGIO ept. ELG: ROON
ActionTaken : ECG MAIN	OCHECKED REP	E IMPROF EROM HE MG Y AND	CHINE A PRINTER	Í MALFUN PRU2HA TI ND FOL HEAD I	O.LS. NOORANAI
	. 4.09.24	Time :	8:00 PM.	. 5	Spare Required
Spare Replaced Descriptio	Requested	Qty.	Part N	lumber	PR Number
Cyrix Engineer SAUBAN IS	IN YASEEN		Date のわ・09・24	Start Time 12:00 PM	
Customer Remar	k Co	ompleted		Ρ	ending ,
rvice Engineer Name : gnature:	SAUBAN	10000	Customer N Signature: Date: 4	lame : 3.1	unc 10: 2889447 9562889447
ate: 이사, 이역 ontact Number: 우귀서		· ( 4	Contact Nui Designation Hospital Se	AIIA	gisc littery

N W Z

## REPAIR OF BIOMEDICAL EQUIPMENTS UNDER BIOMEDICAL EQUIPMENT MAINTENANCE PROGRAM (BEMP)

# Recommendations for Beyond Economic Repair (BER)

## PROFORMA

SI. No	Particulars	Details		
1	Name of District	ALAPPUZHA		
2	Name of Hospital	GH ALAPPUZHA (now Machine at LS NOORANAD)		
3	Name of Equipment with Make, Model and Serial Number	ECG MACHINE MAKE :- BPL MODEL :- CARDIART 6108 T SN :- AVMT0B33822		
+4	Equipment ID & Barcode	124697 & 0410043		
5	Date of purchase / Year of manufacture /Installation Date	23/11/2018		
6	Warranty details (Yes/No)	NO WARRANTY		
7	*AMC/ CAMC Period agreed at the time of purchase	NO AMC/CAMC		
8	Date of breakdown(Date of registration of complaint through email/ Toll free)	22/07/2024		
9	Action taken	Checked the machine and found that the ECG Main PCB, Battery & Printer Head Assembly are defective. Enquired the OEM for spares		
10	Present status of the equipment (Fully damaged / partially damaged)	Fully Damaged		
11	Recommendations for repair (required service details)	Not Recommended For Repair		
12	Cost of spares (specify parts and cost)	Main PCB Assay 6108 T = $14000/-$ NIMH Battery 9.6V, 1.4Ah = $2048/-$ Print Head Assembly 6108 T = $2206.6/-$ Total = $18254.6/-$ (INCLUDING TAX)		

13	Asset Value	RS :- 24080
14	*Percentage value of the cost of spares with respect to Cost of Purchase/ Asset Value	75%
15	Abstract of Service Report provided by the OEM/ Authorized Service Provider/ CYRIX (Attached or Not)	Cyrix Service Report & OEM Quotation Attached.
16	Reasons for recommending the equipment as BER	Checked the machine and found that the ECG Mainboard, Battery & Printer Head Assembly are defective. Enquired the OEM for Quotation. This equipment was installed on 23/11/2018, aged up to 5+ Years. Repairing cost of the equipment is to high (75%) and economically not viable. Both criteria met as per the tender clause 5.3.14.1 So we recommending the equipment as condemnation.
17	Name & Signature of CYRIX Authority	SAUBAN BIN YASEEN

\* Attach Photograph

Remarks and Recommendations of Junior Consultant (Biomedical) NHM:


Recommended for Bell

JYOTHISH PHORA Consultant (Blomedical Eng NHM ALAPPUZHA ering)

Signature of JC BM (NHM)



Dileg-8: 909833534 ECG. Midline Single Channel 11 c. 13. 02.17 Received from State. INVO: Merror Ragt. Code: Casidias + 61087 Nake: Boh, mechica lach: Re. 19, 900/2 Seend No: AVT on echica Re. 19, 900/2 Mayos Eximption Vol. IV Rage: NO: 109 BAR WOR - 6804 7821) 1215) 13-14 555 702/17 Issued on use. 17.75 01-05-2018 ECG machine ASTEN Return back from Dyoligsis unit on 01.05-2018 75). (Note page No.9) n . Balance Machines on Juliens - Fales. 1/2018 3906673 (7) AVER 499 From Dialysis unit on 0105.2018 (Note Page No 9) 23.11.2018 Received From Store: (18E VOI. 4 Page No 332) (8) ECG machine INO BPL CARDOART 6108 T SL. NO AVMTBH 32 001 () PRIZE OF EQUIPME 24080/-BPL Medical rectinologies put 270 Through Kerala Medical service corp KID Condition teen 2 year up to 22.11 2020 TSURG

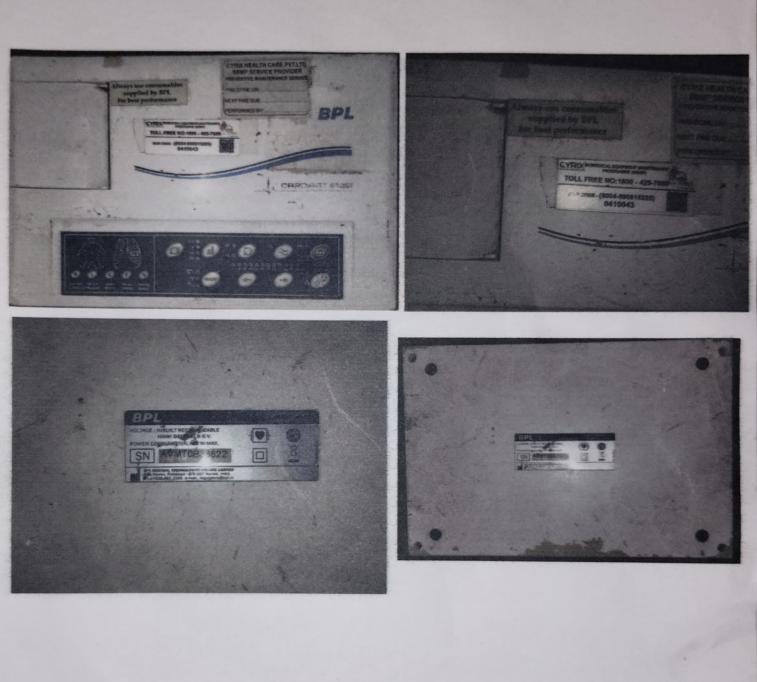



ASSISTATIONSORGEO ASSISTATIONSORGEO Leprost Sacatonum 6 (9 Lu) 6 (9 Lu) L.S. Neolondo



Abhilash A <abhilashacyrix@gmail.com>

### QUOTATION

1 message

**BIOMEDIX SOLUTIONS** <biomedixsales@gmail.com> To: Abhilash A <abhilashacyrix@gmail.com>

Dear sir, please find the document attached herewith

Regards Biomedix Solutions Kottayam



Thu, Sep 5, 2024 at 2:08 PM





### QTN/BISO/050924-058

05/09/2024

## **QUOTATION**

To,

## CYRIX HEALTH CARE PVT LTD ERNAKULAM

Dear Sir,

Please find below our lowest quotation for the following items:-

SL NO.	ITEM DESCRIPTION	QUANTITY	UNIT PRICE	PRICE (incl of all taxes)
1	ECG 6108T MAIN PCB ASSY NEW (WITH LPC IC)	01	12500+12%TAX	14000/-
2	BM/OM NIMH BATTERY 9.6V 1.4 AH	01	1600+28%TAX	2048/-
3	PRINT HEAD ASSY 6108T	01	1870+18%TAX	2206.6/-

Terms and conditions:

- 1. Payment 100% in advance along with Purchase order
- 2. Delivery within 15 days

Thanking you and assuring you our best attention always.

For Biomedix Solutions



Authorized Signatory

#### Mobile: 9846969564

Branches: Kozhikode, Kannur, Kottayam-Kollam. For enquiries contact: <u>biomedixsales@gmail.com</u>, <u>biomedixservice@gmail.com</u>



BIOMEDIX SOLUTIONS No: 7/437- B, Mannarakayam P.O, Kathilankalpadi, Kanjirapally, Kottayam - 686506, Mob:9846969564,